




OWNER INSPECTIONS

1300 471 805

booking@ownerinspections.com.au

<https://www.ownerinspections.com.au/>

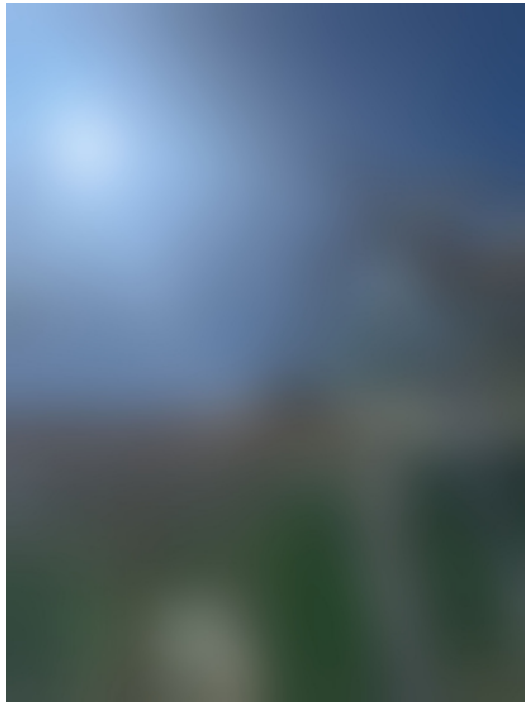

FRAME INSPECTION

Sample Property

Sample Property

Name withheld

16/09/2026



Inspector

Ibrahim Durdu

Registered Building Practitioner

1300 471 805

booking@ownerinspections.com.au



Agent

Name withheld

TABLE OF CONTENTS

1: Inspections Details	11
2: Inspectors Comments	12
3: Retaining Walls	13
4: Concrete Slab - External	14
5: Concrete Slab - Internal	15
6: Roof/Site Drainage System	16
7: + Roof Framing	17
8: + Wall Framing	24
9: + Bracing (Walls Only)	25
10: + Beams and Columns	28
11: + Tie-down - Metal Roof (N2 wind classification)	31
12: + Internal Plumbing	33
13: + Termite Management	36

Inspection Agreement

1. This is an Agreement between you, the undersigned Client, and us, Owner Inspections.
2. If there is more than one Client, you are signing on behalf of all of you, and you represent that you are authorised to do so.
3. 'Owner Inspections' Report carries out in accordance with the guidelines of Australian Standard 4349.1 2007 (Standard) which covers the minimum requirements for the Visual Inspection of residential buildings. The purpose of the Inspection is to provide a visual inspection and provide in-writing advice only to the prospective purchaser/owner regarding the condition of the property at the date and time of Inspection.
4. The Report is NOT a certificate of compliance that the property complies with the requirements of any Act, regulation, ordinance, local law or by-law, local council or other authorities, or as a warranty or an insurance policy against problems developing with the building in the future.
5. The Report is based on the condition of the inspected property at the date and time of Inspection. While the Inspection and Report conducted and prepared with the possible care, still some access limitation and safety hazards can limit the Inspector's ability to detect all defects. These limits and safety items are defined in the standards.
6. The Report assumes that the existing use of the building will continue. If the vendor/owner wishes to change the use of the property, a permit to be acquired from the local authorities.
7. This Report does not include the identification of unauthorised building work or work not compliant with building/council regulations. The Report does not include identification of the municipality regulations and requirements as well as identification of design defects for the construction. According to the Standards, the estimate of the costs of the rectifications is not required in this Report.
8. The construction stage Inspection Report is prepared based on the opinion and assessment of the Inspector at the date and time of the Inspection on the general condition of the inspected property. The Report will not guarantee to include all defects. The Report reflects the quality of workmanship only and will not diminish the responsibility of the builder. The building company has and will have the full responsibility of the build as specified in the law and regulations. This Inspection Report is to Client as a piece of advice and is not a mandatory stage Inspection specified in the Acts and Regulations and building permit.
9. We do not perform engineering, architectural, plumbing, or any other job function requiring an occupational license in the jurisdiction where the property located. If we hold a valid occupational license, we may inform you of this, and you may hire us to perform additional functions. Any agreement for such additional services shall be in a separate writing.
10. Checking Legal matters, building contract, design, easements, local council restrictions and requirements, crossovers, title, boundaries, connections, building

envelope, planning and building permits, setbacks and zonings are out of this Inspection and Report scope of work.

11. The Report will not include defects that may only be apparent in certain weather conditions or defects that have not yet appeared due to prolonged periods of wet or dry weather or other reasons.

12. An inspector shall only inspect areas where safe and unobstructed access provided. Reasonable access is defined in AS4349.1-2007 and this Agreement. Reasonable access does not include removing stored material/goods, nails, screws, cutting or making access hole, and moving furniture.

13. We will not test for the presence of radon, a harmful gas, mould, presence of asbestos, soil contamination, or other environmental hazards or violations.

14. The Report does not identify the presence of pests, or any damage caused by pests (e.g. termites, borers, etc.) unless the Client added to the requested service.

15. The Inspection is not intended to include rigorous assessment of all building elements in a property. Any maintenance and general advice items are a helpful guide only. The Report does not necessarily include all maintenance items.

16. If you request a re-Inspection, the re-Inspection is subject to the terms of this Agreement and re-Inspection fee.

17. The Report will be based on the Inspector's assessment on major defects and safety hazards evident and visually visible on the date and time of the Inspection. The Report will also provide a general assessment of the property and collectively comment on minor defects which would form a regular part of property maintenance.

18. Limitation on Liability and Damages: We are not liable for any cost of repair or replacement of unreported defects, either current or arising in the future. In all cases, our liability is limited to liquidated damages in an amount not greater than 1.5 times the fee you paid us. You waive any claim for consequential, exemplary, special or incidental damages or for the loss of the use of the home/building. You acknowledge that these liquidated damages are not a penalty, but that we intend it to: (i) reflect the fact that actual damages may be difficult or impractical to ascertain; (ii) allocate risk between us; and (iii) enable us to perform the Inspection for the agreed-upon fee. If you wish to eliminate this liquidated damage provision, we are willing to perform the Inspection for an additional fee of \$2,000 payable in advance upon your request.

19. Our Inspection and Report are for your use only. You give us permission to discuss our observations with real estate agents, owners, builders, or other interested parties. You will be the sole owner of the Report and all rights to it. We are not responsible for the use or misinterpretation by third parties, and third parties who rely on it in any way do so at their own risk and release us (including employees and business entities) from any liability whatsoever. You are not allowed to send/show our Report and/or a quotation to our market competitors. If Owner Inspections realise that our competitor has/saw our Report belonging to you and your property, we have the right to take legal action to retrieve damages. If you or any person acting on your behalf provide the Report to a third party who then sues you and/or us, you release us from any liability and agree to pay our costs and legal fees in defending any action naming us. Our Inspection and Report are in no way a guarantee or warranty, express or implied, regarding the future

use, operability, habitability or suitability of the home/building or its components. We disclaim all warranties, express or implied, to the fullest extent allowed by law.

20. You agree that the exclusive venue for any litigation arising out of this Agreement shall be in Australia, where we have our principal place of business. If you fail to prove any claim against us, you agree to pay all our legal costs, expenses and attorneys' fees incurred in defending that claim.

21. If a court declares any provision of this Agreement invalid, the remaining provisions remain in effect. This Agreement represents our entire Agreement; there are no terms other than those set forth herein. All prior discussions are merged into this Agreement. No statement or promise by us shall be binding unless reduced to writing and signed by one of our authorised officers. Any modification of this Agreement must be in writing and signed by you and by one of our authorised officers. This Agreement shall be binding upon and enforceable by the parties and their heirs, executors, administrators, successors and assignees. You will have no cause of action against us after one year from the date of the Inspection.

22. If a court finds any term of this Agreement ambiguous or requiring judicial interpretation, the court shall not construe that term against us because of the rule that any ambiguity in a document is construed against the party drafting it. You had the opportunity to consult qualified legal advice before accepting this Agreement.

23. You may not assign this Agreement.

24. BY BOOKING THE INSPECTIONS, YOU CONFIRM THAT YOU HAVE CAREFULLY READ THIS AGREEMENT. YOU AGREE TO IT AND ACKNOWLEDGE RECEIVING A COPY OF IT.

Purpose of Inspection

The purpose of the Inspection is to provide advice to a prospective purchaser or other interested parties regarding the condition of the property at the time of Inspection.

Conditions of Inspection

An Inspection Report may be conditional on Prevailing weather conditions or recent occupancy and use of services that might affect observations; Information provided by the Client or the agents of the Client; Deliberate concealment of defects; Any other relevant factor limiting the Inspection.

Scope of Inspection

The Inspection shall comprise visual assessment of the property to identify major defects and to form an opinion regarding the general condition of the property at the time of Inspection. Where the Client or other interested party requires only assessment of the structure of the property, the scope of the Inspection shall be limited to that described in Appendix C, AS4349.1-2007. An estimate of the cost of rectification of defects is not required in an Inspection report in accordance with this Standard.

Inspection Records

The Inspector shall record the following information prior to, or during the course of, the Inspection: Identity of the Inspector undertaking the Inspection; Identity of the Client; The address of the property inspected; Date of Inspection; Weather conditions at the

time of the Inspection; Limitations of Inspection with respect to the accessible area; Observation of defects.

Areas for Inspection

The Client shall arrange right of entry, facilitate physical access to the property and supply necessary information to enable the Inspector to undertake the Inspection and prepare a report. The Inspector is not responsible for arranging access to property or parts of the property. Areas where reasonable entry is denied to the Inspector, or where reasonable access is not available, are excluded and do not form part of, the Inspection.

The Inspector shall inspect accessible parts of the building and appurtenances, together with the relevant feature of the property within 30 m of the building and within the boundaries of the site, or as otherwise agreed in the Inspection Agreement. In this context, relevant features include car accommodation, detached laundry, ablution facilities and garden sheds, retaining walls more than 700 mm high, paths and driveways, steps, fencing, earth embankments, surface water drainage and stormwater run-off.

The following areas shall be inspected where applicable: The interior of the building; The roof space; The exterior of the building; The sub-floor space; The roof exterior; The property within 30 m of the building subject to Inspection.

Significant items to be reported are as follows:

(a) Major defects.

(b) A general impression regarding the extent of minor defects, for example, significantly deteriorating exterior paint.

(c) Any major defect that is an urgent and serious safety hazard, for example, unsafe balustrades or imminent collapse of a structural member.

Items to be inspected where applicable:

Interior: Ceilings, Walls, Timber floors, Concrete floors, Timber or steel frames and structure, Timber windows, Metal/Aluminium framed windows, Doors and Frames, Kitchen: Benchtop, Cupboards, Sink/Taps, Tiles, Bathroom/WC/Ensuite: Cistern and pan, Bidet, Taps, Tiles, Bath, Shower, Vanity, Basins, Ventilation, Mirror; Laundry: Taps, Tubs/Cabinet, Tiles, Ventilation; stairs: Stringer, Handrail/Balusters, Treads and risers.

Exterior: Walls, Timber or steel frames and structure, Stairs, Balconies, Verandas, patios, decks, suspended concrete floors, balustrades, Roof, Skylight, Valleys, Guttering, Downpipes, Eaves, Fascia and barges.

Roof Space: Roof covering, Roof framing, Sarking, Party walls, Insulation.

Subfloor Space: Timber Floor, Suspended concrete floors.

The site: Car accommodation, detached laundry, ablution facilities and garden sheds, Retaining walls, Paths and driveways, Steps, Fencing, Surface-water.

Exclusion of items from Inspection:

Footings below ground.

The operation of fireplaces, solid fuel heaters, chimneys and flues.

Electrical appliances including dishwashers, incinerators, ovens, ducted vacuum Systems, Alarm and Intercom systems, air-conditioning.

Swimming pools and associated filtration and similar equipment.

Concealed damp-proof course, plumbing, gas fitting and fixtures.

Concealed tie-downs and bracing, framing-timbers or any areas concealed by wall linings/sidings.

Health hazards (e.g., allergies, soil toxicity, lead content, radon, presence of asbestos or urea-formaldehyde).

Soil conditions, control joints.

Sustainable development provisions, Environmental matters (e.g., BASIX, water tanks, NCC Environmental Provisions), Energy and lighting efficiency, Landscaping.

Rubbish, Stored items, furniture and accessories.

Safe and reasonable access

The extent of accessible areas shall be determined by the Inspector at the time of Inspection,

based on the conditions encountered at the time of Inspection. The Inspector shall also determine whether sufficient space is available to allow safe access. The Inspection shall include only accessible areas and areas that are within the Inspector's line of sight and close enough to enable reasonable appraisal. Reasonable access shall be determined as below:

Roof interior: minimum 400mm x 500mm access hole, 600mm x 600mm crawl space, accessible from a 3.6m ladder.

Roof exterior: Accessible from a 3.6m ladder placed on the ground.

Sub Floor Area: 400mm x 500mm access hole; 400mm x 500mm crawl space.

Reasonable access does not include the cutting of access holes or the removal of screws and bolts or any other fastenings or sealants to access covers.

Subfloor areas sprayed with chemicals are not to be inspected unless it is safe to do so. Areas, where reasonable entry is denied to the Inspector or where reasonable access is not available, are excluded from and do not form part of the Inspection.

Access Limitation:

The Inspector will conduct a non-invasive visual Inspection which will be limited to those accessible areas and sections of the property to which Safe and Reasonable Access is both available and permitted on the date and time of the Inspection. Areas where reasonable entry is denied to the Inspector, or where safe and reasonable access is not available, are excluded from and do not form part of, the Inspection. Those areas may be the subject of an additional Inspection upon request following the provision or reasonable entry and access.

The Inspection excludes the inside of walls, between floors, inside skillion roofing, inside the eaves, behind stored goods in cupboards, and other areas that are concealed or

obstructed. The Inspector will not dig, gouge, force or perform any other invasive procedures.

Examples of access limitations:

Legal right of entry, locked doors/windows, security systems, pets, furniture or other Obstructions, Height, narrow boundary clearances, thick vegetation, small roof or crawl space, adverse weather conditions.

The Report shall identify any area or item within the scope of the Inspection that was not inspected and the factor that prevented Inspection.

Acceptance criteria:

The building shall be compared with a building that was constructed in accordance with the generally accepted practice at the time of construction and which has been maintained such that there has been no significant loss of strength and serviceability.

Definitions

Access hole (cover): An opening in flooring or ceiling or other parts of a structure (such as service hatch, removable panel) to allow for entry to carry out an Inspection, maintenance or repair.

Accessible area: An area of the site where sufficient, safe and reasonable access is available to allow Inspection within the scope of the Inspection.

Building element: Portion of a building that, by itself or in combination with other such parts, fulfils a characteristic function.

Client: The person or other entity for whom the Inspection is being carried out.

Defect: Fault or deviation from the intended condition of a material, assembly, or component.

Inspection: Close and careful scrutiny of a building carried out without dismantling, in order to arrive at a reliable conclusion as to the condition of the building.

Inspector: Person who is responsible for carrying out the Inspection.

Limitation: Any factor that prevents full or proper Inspection of the building.

Structural defect: Fault or deviation from the intended structural performance of a building element.

Structural element: Physically distinguishable part of a structure; for example, wall, columns, beam, connection.

Subfloor space: Space between the underside of a suspended floor and the ground.

Roof space: Space between the roof covering and the ceiling immediately below the roof covering.

Site: Allotment of land on which a building stands or is to be erected.

Defect Categories:

Visually Fine (F): Item inspected and is visually fine.

General Advice (G): A general advice item is neither defect nor fine. It is only a recommendation/advice/description by Inspector.

Defect (D): Fault or deviation from the intended condition of a material, assembly, or component. Repair is recommended on Defect items.

Major Defect (M): A defect that can cause further severe damage (structural or non-structural) to the property or make it unsafe. The rectification must carry out ASAP to avoid damages/injuries.

Unable to Inspect (U): An area where the Inspector could not inspect at the time of Inspection due to one or more safe/reasonable access limitations.

Not Applicable (N): An item that is not applicable to the area of the Inspection.

Please note: this report is ***not tribunal compliant and can not be used for any legal proceedings***. If you need a report to pursue to tribunal or court, please get in touch with our office to book an expert witness inspection, and one of our experts will attend the site and provide a Tribunal-compliant inspection report.

NEED RE-INSPECTION?

Once your builder informs you that the defects are rectified, you can book a reinspection. During the re-inspection, our inspector attends the site and checks if all defects have been rectified. Both resolved and unresolved defects will be documented and the full report will be sent to you to help you get your builder to fix all defects before the defects are covered, and construction goes to the next stage.

Simply you can book this service online [HERE](#).

20

GENERAL ADVICE/MAINTENANCE ITEM

- 🔧 2.1.1 Inspectors Comments - Inspection Summary: Overall Conditions - good
- 🔧 7.1.1 + Roof Framing - Roof Trusses: Web ties
- 🔧 7.1.2 + Roof Framing - Roof Trusses: Anti crush plates installed
- 🔧 7.1.3 + Roof Framing - Roof Trusses: Cyclone tie
- 🔧 7.1.4 + Roof Framing - Roof Trusses: Cyclone tie double face
- 🔧 7.1.5 + Roof Framing - Roof Trusses: Visually fine
- 🔧 7.2.1 + Roof Framing - Roof Bracings: Visually Fine
- 🔧 7.3.1 + Roof Framing - + Hip trusses: + Straight
- 🔧 7.4.1 + Roof Framing - + Triple grips (Truss tie): + Visually Fine
- 🔧 9.3.1 + Bracing (Walls Only) - + Metal Angle Brace/Strap: K brace
- 🔧 9.5.1 + Bracing (Walls Only) - + Fixing - Metal Strap/Angle Brace: Locations
- 🔧 9.6.1 + Bracing (Walls Only) - + Bracing Tie down bolts/nails: K brace tie down bolts
- 🔧 9.6.2 + Bracing (Walls Only) - + Bracing Tie down bolts/nails: According to plan
- 🔧 10.2.1 + Beams and Columns - + Timber External Beams/Lintels: + Visually Fine
- 🔧 10.4.1 + Beams and Columns - + Steel columns/posts: + Appear fine
- 🔧 11.1.1 + Tie-down - Metal Roof (N2 wind classification) - + Bottom Plate to floor frame or slab: Visually fine
- 🔧 11.3.1 + Tie-down - Metal Roof (N2 wind classification) - + Beams/Lintels to Posts/Studs: According to plan
- 🔧 11.4.1 + Tie-down - Metal Roof (N2 wind classification) - + Washers: Visually fine
- 🔧 12.1.1 + Internal Plumbing - + Location: Correct locations
- 🔧 13.1.1 + Termite Management - + Physical Barriers: + Not installed

1: INSPECTIONS DETAILS

		F	G	D	M	U	N
1.1	General						
1.2	Videos						

F = Visually Fine G = General Advice D = Defect M = Major Defect U = Unable to Inspect N = Not Applicable

Information

General: In Attendance

Trades People

General: Weather Conditions

Clear

**General: Documentation
Provided**

Architectural Plans Supplied,
Engineering Plans Supplied

General: Building Classification

Residential

General: Age of Building

New Build

General: Number of Levels

Single Storey

General: Piers

Not Applicable

General: Claddings

Not Completed

General: Floor Coverings

Slab

Videos: Walk Through Video



Limitations

General

ACCESS TO THE PROPERTY

Height

2: INSPECTORS COMMENTS

		F	G	D	M	U	N
2.1	Inspection Summary	X	X				

F = Visually Fine G = General Advice D = Defect M = Major Defect U = Unable to Inspect N = Not Applicable

Observations

2.1.1 Inspection Summary

 General Advice/Maintenance Item

OVERALL CONDITIONS - GOOD

The frame was generally observed to have been constructed to an acceptable standard

Please Note: This is a general appraisal only and cannot be relied on its own – read the report in its entirety. This summary is supplied to provide a quick and superficial overview of the inspection results. This Summary is NOT the Report and cannot be relied upon on its own. This Summary must be read in conjunction with the full report and not in isolation from the report. If there should happen to be any discrepancy between anything in the Report and anything in this Summary, the information in the Report shall override that in this Summary.

3: RETAINING WALLS

		F	G	D	M	U	N
3.1	Structural Elements						X
3.2	Waterproofing and Drainage Elements						X

F = Visually Fine G = General Advice D = Defect M = Major Defect U = Unable to Inspect N = Not Applicable

Limitations

Structural Elements
+ VISUAL INSPECTION ONLY

Limitations

We highlight that the inspection of retaining wall waterproofing and drainage elements is a visual inspection only. We recommend a suitably licensed and experienced plumber be engaged to conduct a thorough CCTV inspection of all in-ground drains to ensure their adequacy prior to handover.

4: CONCRETE SLAB - EXTERNAL

		F	G	D	M	U	N
4.1	Rebates/Edges		X				
4.2	Vapour Barriers						X

F = Visually Fine G = General Advice D = Defect M = Major Defect U = Unable to Inspect N = Not Applicable

5: CONCRETE SLAB - INTERNAL

		F	G	D	M	U	N
5.1	Set-out and Reduced Levels (RLs)		X				
5.2	Shower Recess		X				
5.3	Levelness of Concrete Surface	X	X				
5.4	Cracks	X	X				

F = Visually Fine G = General Advice D = Defect M = Major Defect U = Unable to Inspect N = Not Applicable

Limitations

Set-out and Reduced Levels (RLs)

OUT OF SCOPE OF WORK

We are unable to confirm that the concrete slab on-ground has been built in accordance with the reduced levels (RLs) and set-out detailed in the design documents provided. The builder and land surveyor are responsible for setting out the works on site and determining the reduced levels.

6: ROOF/SITE DRAINAGE SYSTEM

		F	G	D	M	U	N
6.1	Site Grading		X				
6.2	Gutters and Fascia		X				
6.3	Underground Stormwater pipes		X				

F = Visually Fine

G = General Advice

D = Defect

M = Major Defect

U = Unable to Inspect

N = Not Applicable

Limitations

Underground Stormwater pipes

SILT PITS LEVEL - OUT OF SCOPE OF WORK

Determining and confirming the level of the silt pits is outside the scope of this building inspection. This should be assessed and confirmed by a licensed plumber and included in the plumber's compliance certificate.

7: + ROOF FRAMING

		F	G	D	M	U	N
7.1	Roof Trusses		X				
7.2	Roof Bracings		X				
7.3	+ Hip trusses	X	X				
7.4	+ Triple grips (Truss tie)	X	X				
7.5	+ Truss boots						X
7.6	+ Bracket fixings		X				
7.7	+ Fascia						X
7.8	+ Gutters						X
7.9	+ Valley boards						

F = Visually Fine

G = General Advice

D = Defect

M = Major Defect

U = Unable to Inspect

N = Not Applicable

Observations

7.1.1 Roof Trusses

WEB TIES

According to plan

 General Advice/Maintenance Item

10:28

 64%

 29773T WEB BRA...

Web Ties & Stiffeners

Some truss designs require longitudinal ties, stiffeners or other supplementary members to be applied to webs. Where longitudinal ties are used, they should be 70 x 35 (F5) or as specified by the truss fabricator. Where longitudinal ties are used, they should be continuous and fixed to web of each truss at mid-height with 2 x 3.75 dia. nails and braced back to truss with one bay of crossed SpeedBrace at each end and intermediate bay at 10m centres fixed as shown below. Ties may be spliced by lapping over 2 adjacent trusses.

Web stiffeners may be specified in lieu of web ties where it is difficult to fit web ties because of the small number of trusses or the varying position of the webs, eg. Truncated trusses and Hip trusses.

Web stiffeners may be timber sections fitted on-site or steel Eliminator stiffeners fixed during manufacture. Where timber stiffeners are used these should be the size and grade specified by the truss designer and should be continuous for the full length of the web. Timber stiffeners are to be fixed as below.

Bend brace over chord and fix with 5 nails to face of chord. Typical both ends of brace.

2 nails to web of each intersection and truss


Brace to cross web at mid-height to match tie

Web ties as specified. Fix to each truss web at mid-height with 2 x 3.75mm nails.

Angle of brace to web tie to be between 30° and 45°

3.15mm dia. nails at 225mm max. centres

3.15mm dia. nails at 225mm max. centres staggered to each member

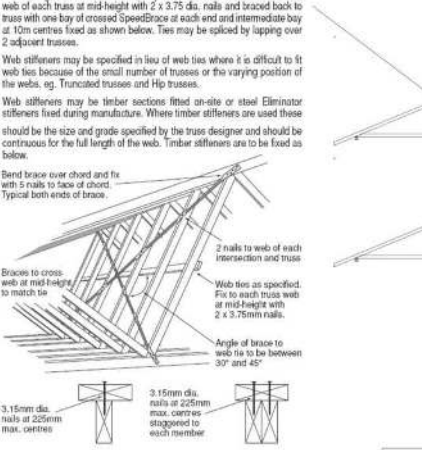





OWNER INSPECTIONS


Page 18 of 36

7.1.2 Roof Trusses

ANTI CRUSH PLATES INSTALLED

According to plan

 General Advice/Maintenance Item

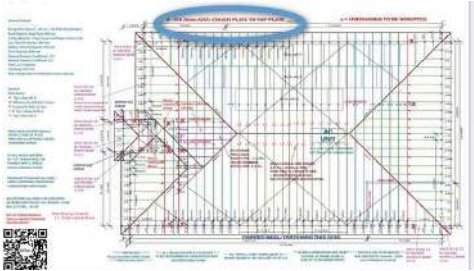


7.1.3 Roof Trusses

CYCLONE TIE

According to plan

 General Advice/Maintenance Item

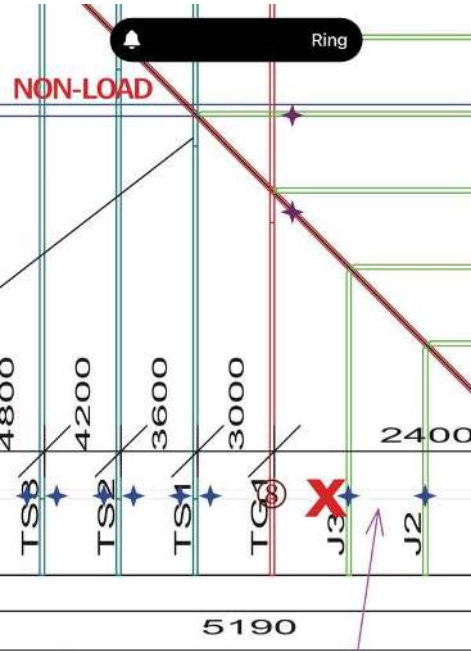

TO BE BRACED **
TO AS4440 - 2004
(see section booklet)

200 X 45 LVL 13
H2 TREATED
ALFRESCO BEAM
1/5.4

7.1.4 Roof Trusses

CYCLONE TIE DOUBLE FACE

Installed

 General Advice/Maintenance Item



Symbols

Hold-Downs:

- ✦: Trip-L-Grip Left A
- ✂✂ Cyclone Tie 900 Dbl 12 Face
- Ⓢ: Cyclone Tie 600 12 Face
- ✦✦: Trip-L-Grip Left Dbl A
- ✦: Trip-L-Grip Left A

FIRST JACK LOCATED 600mm FROM O/SIDE OF PLATE THEN 600mm SPACING UNLESS OTHERWISE NOTED

FIX ALL JACKS/RAFTERS TO "TG" HORIZONTAL TOP CHORDS WITH 1/BT195 (unless otherwise noted)

INSTALLER TO ENSURE ALL EAVE / GABLE OVERHANG DIMENSIONS CORRESPOND WITH PLANS

BLK RAFTERS ALLOWED FOR EXTENSION OF TRUNCATED TRUSS TOP CHORDS TO HIP
BLK 22.5 DEG - 40 off

TOP OF PORCH BEAM IS 300mm ABOVE STANDARD CEILING HEIGHT


Web Bracing
L1: Single L



7.1.5 Roof Trusses

VISUALLY FINE

General Advice/Maintenance Item

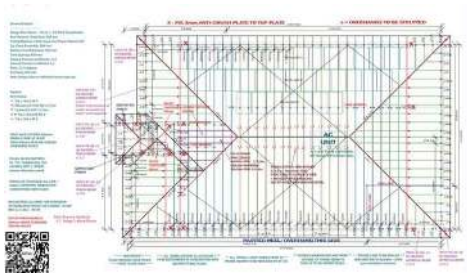


7.2.1 Roof Bracings

VISUALLY FINE

General Advice/Maintenance Item

The roof bracings appear visually in good condition with no obvious signs of damage or misalignment observed during the inspection.

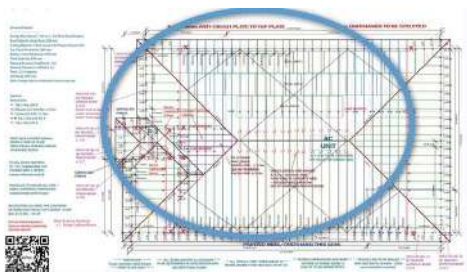

7.3.1 + Hip trusses

+ STRAIGHT

General Advice/Maintenance Item

Hip trusses being inspected and were straight at the time of inspection.




7.4.1 + Triple grips (Truss tie)

+ VISUALLY FINE

General Advice/Maintenance Item

Triple grips (truss tie) were visually fine at the time of inspection.

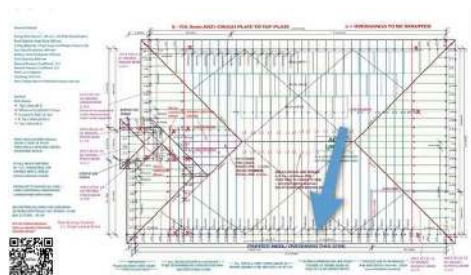

8: + WALL FRAMING

		F	G	D	M	U	N
8.1	+ General		X				
8.2	+ Slotted brackets	X					
8.3	+ Wall Fixings	X					
8.4	+ Junction Fixings	X					
8.5	+ Plumbness	X					
8.6	+ Frame/Opening Clearance	X					
8.7	+ Window Sill Trimmers	X					
8.8	+ Noggings	X					
8.9	+ Window/Door Lintels	X					
8.10	+ Jamb Studs	X					
8.11	+ Studs	X					
8.12	+ Bottom Plates	X					
8.13	+ Top plates	X					
8.14	+ Internal Load-bearing walls	X					
8.15	+ Support Points	X					
8.16	+ Bracket Fixings	X					
8.17	+ Bulkheads		X				
8.18	+ Windows		X				

F = Visually Fine

G = General Advice

D = Defect

M = Major Defect

U = Unable to Inspect

N = Not Applicable

9: + BRACING (WALLS ONLY)

		F	G	D	M	U	N
9.1	+ General	X					
9.2	+ Plywood/Hardboard Bracing						X
9.3	+ Metal Angle Brace/Strap		X				
9.4	+ Fixing - Plywood/Hardboard						
9.5	+ Fixing - Metal Strap/Angle Brace	X	X				
9.6	+ Bracing Tie down bolts/nails	X	X				

F = Visually Fine

G = General Advice

D = Defect

M = Major Defect

U = Unable to Inspect

N = Not Applicable

Information

+ General: BRACING INFORMATION

Bracing works to maintain rigidity of the structure in all points, prevent any displacements or other ways of deformation . Bracing shall be provided to stud walls to resist horizontal forces (wind, storm, earthquakes, etc.) applied to the building. Appropriate connections shall also be provided to transfer these forces through the framework and subfloor structure to the building foundation.

Observations

9.3.1 + Metal Angle Brace/Strap



General Advice/Maintenance Item

K BRACE

According to plan




9.5.1 + Fixing - Metal Strap/Angle Brace

LOCATIONS

According to plan



General Advice/Maintenance Item

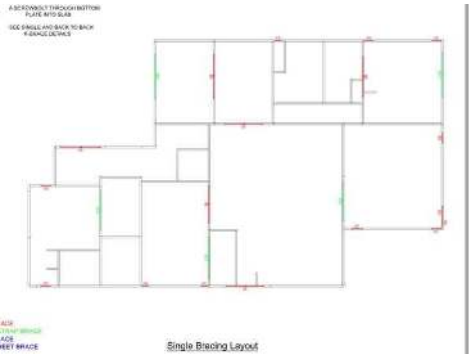

9.6.1 + Bracing Tie down bolts/nails

K BRACE TIE DOWN BOLTS

According to plan



General Advice/Maintenance Item



EACH ENDS OF ALL BRACES REQUIRE A SCREWBOLT THROUGH BOTTOM PLATE INTO SLAB.

SEE SINGLE AND BACK TO BACK K-BRACE DETAILS


9.6.2 + Bracing Tie down bolts/nails

ACCORDING TO PLAN

According to plan



General Advice/Maintenance Item

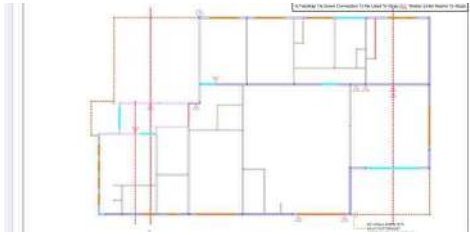

10: + BEAMS AND COLUMNS

		F	G	D	M	U	N
10.1	+ Timber Internal Beams/Lintels						X
10.2	+ Timber External Beams/Lintels		X				
10.3	+ Steel Beams						X
10.4	+ Steel columns/posts	X	X				

F = Visually Fine G = General Advice D = Defect M = Major Defect U = Unable to Inspect N = Not Applicable

Observations

10.2.1 + Timber External Beams/Lintels

+ VISUALLY FINE

Visually fine at time of inspection.



General Advice/Maintenance Item



10.4.1 + Steel columns/posts

+ APPEAR FINE

Appear fine.



General Advice/Maintenance Item



11: + TIE-DOWN - METAL ROOF (N2 WIND CLASSIFICATION)

		F	G	D	M	U	N
11.1	+ Bottom Plate to floor frame or slab	X	X				
11.2	+ Top & Bottom Plates To Studs	X	X				
11.3	+ Beams/Lintels to Posts/Studs	X	X				
11.4	+ Washers	X	X				

F = Visually Fine G = General Advice D = Defect M = Major Defect U = Unable to Inspect N = Not Applicable

Observations

11.1.1 + Bottom Plate to floor frame or slab

VISUALLY FINE

 General Advice/Maintenance Item



11.3.1 + Beams/Lintels to
Posts/Studs

ACCORDING TO PLAN

 General Advice/Maintenance Item



11.4.1 + Washers
VISUALLY FINE

 General Advice/Maintenance Item



12: + INTERNAL PLUMBING

		F	G	D	M	U	N
12.1	+ Location		X				
12.2	+ Capping and Damages		X				

F = Visually Fine G = General Advice D = Defect M = Major Defect U = Unable to Inspect N = Not Applicable

Observations



12.1.1 + Location

CORRECT LOCATIONS

According to plan



General Advice/Maintenance Item

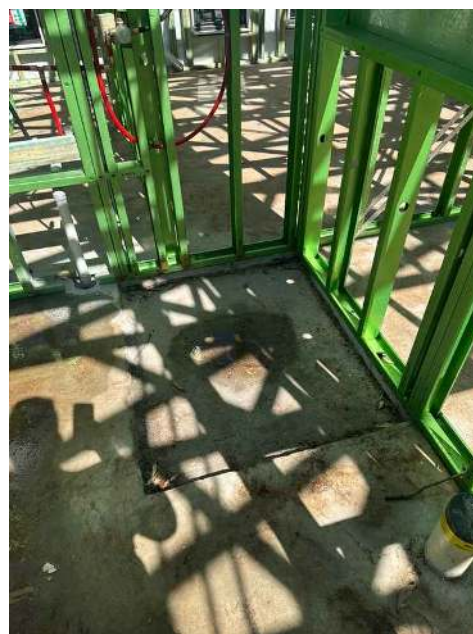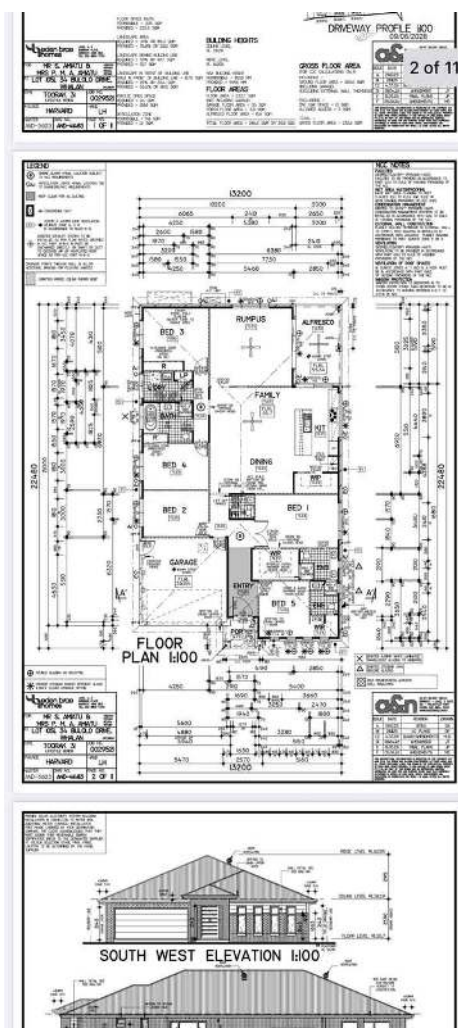



13: + TERMITE MANAGEMENT

		F	G	D	M	U	N
13.1	+ Physical Barriers		X				
13.2	+ Termite Management Notice						X

F = Visually Fine

G = General Advice

D = Defect

M = Major Defect

U = Unable to Inspect

N = Not Applicable

Observations

13.1.1 + Physical Barriers

+ NOT INSTALLED



General Advice/Maintenance Item

Termite physical barrier under the external walls have not been installed at the time of inspection. Builder to confirm either if this property is not subject to termite attack risk or other termite management (for example chemical) to be used.

National Construction Codes (NCC) - 3.1.4.3 Termite management systems:

Where a termite management system is required it must:

(a) be selected appropriate to Table (Figure) 3.1.4.1; and

(b) comply with:

(i) AS 3660.1; or

(ii) have been tested and passed the tests required by Section 5 of AS 3660.3; and

(c) have a durable notice installed in accordance with 3.1.4.4; and

(d) where a chemical termite management system is used, the chemical must be included on the appropriate authority's pesticides register.

